

7/8" RF-connectors

Type 876

Installation instructions

for 7/8" 50 AL

Please follow this guide for safe installation in seconds.

(Recommended Corning Cabelcon tools – item no. 28187650)



1. Cut your cable using your standard tools and procedures.




2. Strip the jacket using the jacket tool. Press and turn until the mechanical stop is reached.



3. After the stripping operation the cable should look like this.




4. Insert the tool guide as shown...

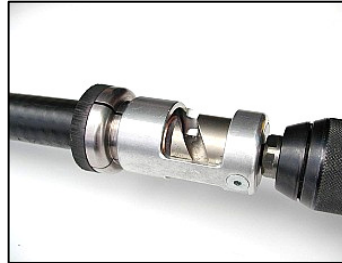


5. - and strip the cable. Press against the cable and turn slowly (app. 300 rpm) until the physical stop is reached.



6. Remove the tool guide and repeat the jacket stripping operation in step 2.

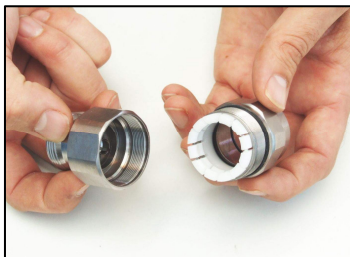

7. Separate the two parts of the connector.

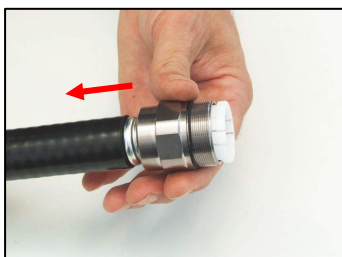

8. "Click" the back nut on the cable. **Attention:** Make sure not to push out the O-ring when the cable is inserted!



9. - like this.



10. Press the front part in position against the cable and screw the back nut against the front as far as possible by hand.



11. Tighten to mechanical stop by the use of two spanners. Tighten by rotating the back nut while holding the front nut stationary.

We recommend the use of Cabelcon's special designed preparation tools (item no. 28187650) for the easiest and safest installation.

Please always read the instructions supplied with the tools.

Rev. 25.04.08

CABELCON
connectors

www.cabelcon.dk